

Panda Tire & Auto

57
Items are
OK!



2009 Mazda 6 (BREJ555)

License Plate: BREJ555

VIN: 1YVHP81A195M26505

Test Drive:

Mileage In: 98765

Front Tire Size: P205/65

Rear Tire Size: P205/65



From:

John Smith

Service Manager

info@autoserve1.com

Mike's AutoServe1 Service

2100 2 st clair ave w

416 614 1020



Inspection Performed By:

John Smith

Technician

Customer

Steve Parker

AutoServe1

steveg+testaccount0i080@autoserve1.com

4164334839

Customer Feedback

Thank you for your feedback!



CLICK HERE TO VIEW YOUR
SCHEDULED MAINTENANCE

STEVE PARKER #001-1111

VEHICLE CONDITION REPORT (FEBRUARY 19, 2016)

Reason for Today's Visit

LOF

Wheel pulls to the left

Dash lights



57 items are OK!

8 items have service suggested

10 items have service required

Engine oil


Finding: Dirty

Recommendation: Recommend change/flush

Photos (Click to view)



Why it's important (Click to view)

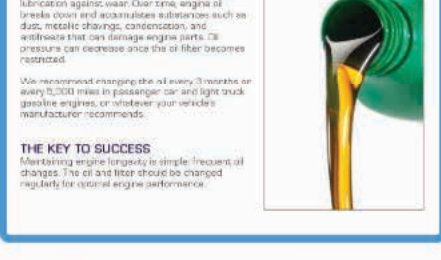

Oil Changes

Dash warning light

Finding: Engine light on

Recommendation: Requires further diagnosis

Check Engine light: **ON**

4 Trouble Codes are present

Why it's important (Click to view)



Engine Diagnostics


Cabin/pollen air filter

Finding: Cabin air filter dirty

Recommendation: Replace filter

Reason for recommendation: Part no longer performs intended function

Photos (Click to view)

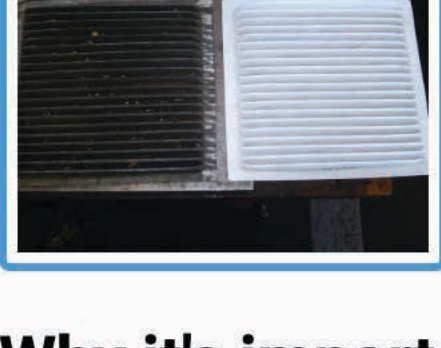

Why it's important (Click to view)



Cabin Air Filter

Front pads

Finding: Front brake pads at service limit

Recommendation: Replace front brake pads

Reason for recommendation: Part no longer performs intended function

Observations


Driver side brake pads: 2 mm

Passenger side brake pads: 1 mm

Photos (Click to view)



Why it's important (Click to view)

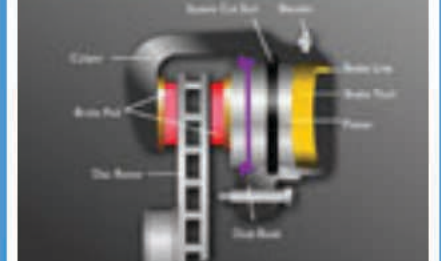

Braking Assembly

Front rotors

Finding: Cracked

Recommendation: Replace front brake rotors


Reason for recommendation: Part does not meet design or specification

Observations


Driver side brake rotors: more than 15mm

Passenger side brake rotors: more than 15mm

Photos (Click to view)

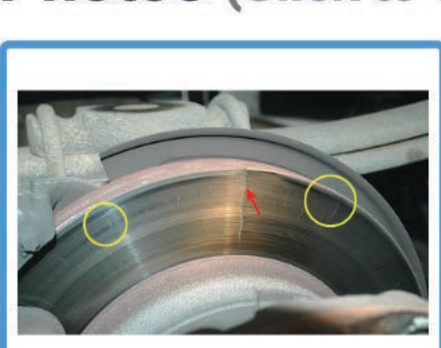

Why it's important (Click to view)

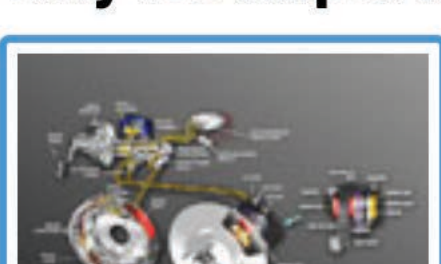

Braking

Rear pads/shoes

Finding: Rear brake pads at service limit

Recommendation: Replace rear brake pads


Reason for recommendation: Part no longer performs intended function

Observations

Driver side brake pads: 1 mm

Passenger side brake pads: 1 mm

Why it's important (Click to view)

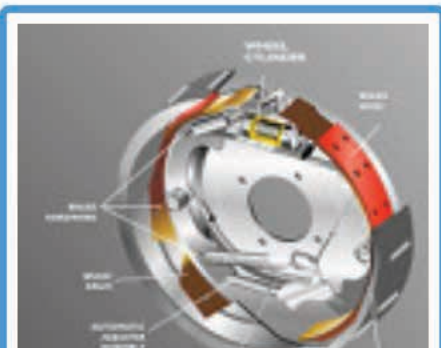

Brake Drum

Steering components

Finding: Loose outer tie rod

Recommendation: Replace driver side tie rod

Videos (Click to view)




CV drive axle boots

Finding: Ripped/leaking

Recommendation: Replace

Reason for recommendation: Part no longer performs intended function

Photos (Click to view)

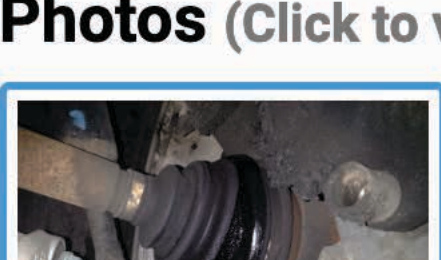

Why it's important (Click to view)



Driveline

Body damage

Finding: Visible sign of body damage

Recommendation: Requires body estimate


Wheel alignment

Finding: Out of manufacturer's specification

Recommendation: Perform comprehensive alignment inspection

Reason for recommendation: Part does not meet design or specification

Front

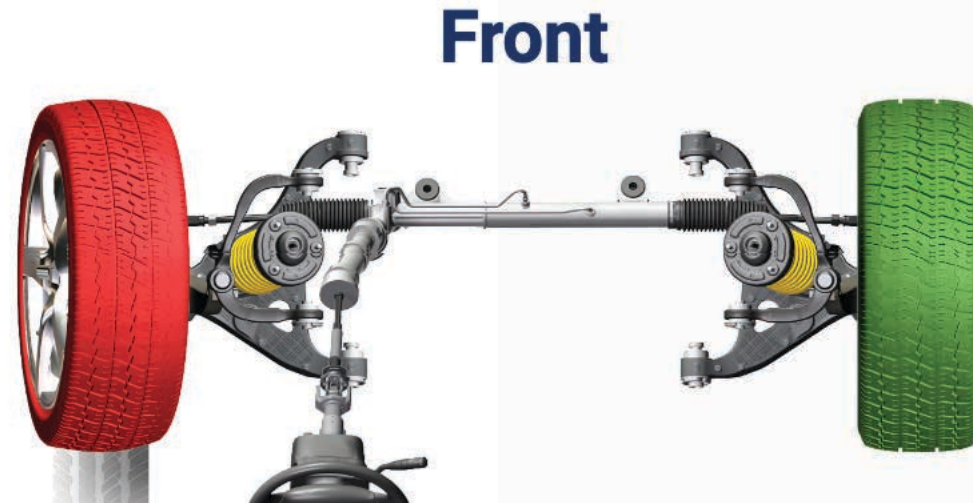

Left

Right


Rear



Left

Right

Why it's important (Click to view)

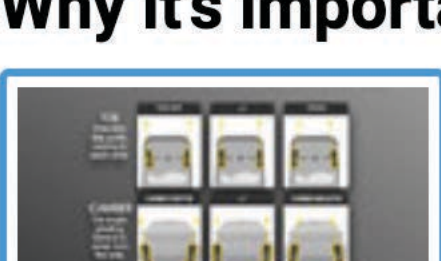

Wheel alignment